

UNCLASSIFIED

AD NUMBER
AD488710
NEW LIMITATION CHANGE
TO Approved for public release, distribution unlimited
FROM Distribution authorized to U.S. Gov't. agencies and their contractors; Administrative/Operational Use; Sep 1966. Other requests shall be referred to Commander, Air Force Materials Lab., Wright-Patterson AFB, OH.
AUTHORITY
AFWL ltr, 12 Jan 1972

THIS PAGE IS UNCLASSIFIED

AFML-TR-66-12

STRESS CORROSION AND FATIGUE TESTS ON 7001-T75 ALUMINUM ALLOY

W. E. Evans
A. G. Chambers

THE BOEING COMPANY
Wichita Division

TECHNICAL REPORT AFML-TR-66-12

SEPTEMBER 1966

This document is subject to special export controls and each transmittal to foreign governments or foreign nationals may be made only with prior approval of the Air Force Materials Laboratory (MAAS), Wright-Patterson Air Force Base, Ohio 45433

Air Force Materials Laboratory
Research and Technology Division
Air Force Systems Command
Wright-Patterson Air Force Base, Ohio

NOTICES

When Government drawings, specifications, or other data are used for any purpose other than in connection with a definitely related Government procurement operation, the United States Government thereby incurs no responsibility nor obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data, is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use, or sell any patented invention that may in any way be related thereto.

Copies of this report should not be returned to the Research and Technology Division unless return is required by security considerations, contractual obligations, or notice on a specific document.

AFML-TR-66-12

STRESS CORROSION AND FATIGUE TESTS
ON 7001-T75 ALUMINUM ALLOY

W. E. Evans

A. G. Chambers

This document is subject to special export controls and each transmittal to foreign governments or foreign nationals may be made only with prior approval of the Air Force Materials Laboratory (MAAS), Wright-Patterson Air Force Base, Ohio 45433

FOREWORD

This investigation of the 7001-T75 aluminum alloy was conducted by The Boeing Company, Wichita Division, Wichita, Kansas under USAF Contract No. AF33(657)-7086 CCN4 (4N-860). This contract was initiated under Project No. 7381, "Materials Application," Task No. 738103, "Data Collection and Correlation." This work was under the direction of the Air Force Materials Laboratory, Research and Technology Division, Wright-Patterson Air Force Base, Ohio, with Mr. C. B. Ward and Lt D. E. Tibovich, Project Engineers. The contract period was from October 1963 through May 1966. The manuscript was released by the authors in June 1966 for publication as a technical report.

The data contained in this report pertaining to the 7075-T73, 7079-T6, 7079-T62, and 7079-T611 aluminum alloys was obtained from a separate test program which was under USAF Contract No. AF33(657)-7086 Supplemental Agreement Number 2.

The investigation of the 7001-T75 aluminum alloy was carried out under the direction of Mr. W. E. Evans and the report was prepared by Mr. A. G. Chambers.

This technical report has been reviewed and is approved.

W. P. Conrardy

W. P. CONRARDY, Chief
Systems Support Branch
Materials Applications Division
Air Force Materials Laboratory

ABSTRACT

Test specimens of 7001-T75 aluminum alloy were evaluated for resistance to stress corrosion and for fatigue characteristics. Alternate immersion stress corrosion tests were performed at gross area stress levels of 50 ksi, 30 ksi, and 20 ksi with steel Taper-Lok and titanium lockbolt fasteners installed in plain and cold worked holes. These fasteners were installed with clearance and interference fits. This report also includes, for comparison purposes, similar stress corrosion data on 7075-T73, 7079-T6, 7079-T62, and 7079-T611 aluminum alloy. The data for these four alloys was obtained from a separate contract. Fatigue tests were performed at 15 ± 5 ksi and 15 ± 10 ksi mean plus alternating stress levels. The test configurations included an open hole monoblock design and a strap reinforcement design with steel Taper Lok fasteners. This report also includes, for comparison purposes, similar fatigue test data on 7075-T73 and 7079-T62 aluminum alloys. The data for these two alloys was obtained from a separate contract. The 7001-T75 alloy exhibited very good resistance to stress corrosion cracking at 50 ksi gross area sustained stress. The limited number of fatigue tests indicated that the 7001-T75 alloy is potentially superior to 7075-T73 and 7079-T62.

CONTENTS

		<u>PAGE</u>
I	INTRODUCTION.....	1
II	STRESS CORROSION TESTS.....	2
	1. Material.....	2
	2. Specimens.....	2
	3. Fasteners.....	3
	4. Stress Corrosion Test Procedure.....	3
	5. Post Test Inspection.....	3
	6. Test Conditions.....	4
III	STRESS CORROSION TEST RESULTS AND DISCUSSION.....	5
	1. 20 Ksi.....	5
	2. 30 Ksi.....	5
	3. 50 Ksi.....	5
IV	FATIGUE TESTS.....	7
	1. Fatigue Test Procedures.....	7
V	FATIGUE TEST RESULTS AND DISCUSSION.....	8
VI	CONCLUSIONS AND RECOMMENDATIONS.....	9

LIST OF FIGURES

	<u>PAGE</u>
Figure 1 Layout Sketch - 7001-T75 Plate for Stress Corrosion Specimens	10
Figure 2 Specimen Configuration - Stress Corrosion Tests	11
Figure 3 Constant Load Fixture Used for Stress Corrosion Testing	12
Figure 4 Specimen in a Constant Load Stress Corrosion Test Fixture	13
Figure 5 Typical 7001-T75 Specimen with Steel Taper-Lok Fastener which Failed by Stress Corrosion	14
Figure 6 Typical Fracture Face of 7001-T75 Stress Corrosion Specimen	15
Figure 7 Electron Photomicrograph of 7075-T73 Stress Corrosion Failure	16
Figure 8 Electron Photomicrograph of 7001-T75 Stress Corrosion Failure	17
Figure 9 Electron Photomicrograph of 7001-T75 Stress Corrosion Failure	18
Figure 10 Material Life Hours	19
Figure 11 Material Life Hours	20
Figure 12 Material Life Hours	21
Figure 13 Material Life Hours	22
Figure 14 Strap Reinforcement Specimen Configuration - Fatigue Tests	23

LIST OF TABLES

	PAGE
Table I Chemical Composition of 7079, 7001, and 7075	24
Table II Mechanical Properties of Test Material	25
Table III Failure Times at 50 Ksi for 7079-T62 and 7079-T6 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	26
Table IV Failure Times at 30 Ksi for 7079-T62 and 7079-T6 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	27
Table V Failure Times at 20 Ksi for 7079-T62 and 7079-T6 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	28
Table VI Failure Times at 50 Ksi for 7079-T62 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	29
Table VII Failure Times at 30 Ksi for 7079-T62 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	30
Table VIII Failure Times at 20 Ksi for 7079-T62 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	31
Table IX Failure Times at 50 Ksi for 7079-T611 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	32
Table X Failure Times at 30 Ksi for 7079-T611 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	33
Table XI Failure Times at 20 Ksi for 7079-T611 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	34
Table XII Failure Times at 50 Ksi for 7079-T611 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	35
Table XIII Failure Times at 30 Ksi for 7079-T611 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	36
Table XIV Failure Times at 20 Ksi for 7079-T611 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	37
Table XV Failure Times at 50 Ksi for 7075-T73 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	38

	<u>PAGE</u>
Table XVI Failure Times at 30 Ksi for 7075-T73 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	39
Table XVII Failure Times at 20 Ksi for 7075-T73 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	40
Table XVIII Failure Times at 50 Ksi for 7075-T73 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	41
Table XIX Failure Times at 30 Ksi for 7075-T73 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	42
Table XX Failure Times at 20 Ksi for 7075-T73 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	43
Table XXI Failure Times at 50 Ksi for 7001-T75 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	44
Table XXII Failure Times at 30 Ksi for 7001-T75 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	45
Table XXIII Failure Times at 20 Ksi for 7001-T75 Specimens with 1/4 Inch Steel Taper-Lok Fasteners	46
Table XXIV Failure Times at 50 Ksi for 7001-T75 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	47
Table XXV Failure Times at 30 Ksi for 7001-T75 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	48
Table XXVI Failure Times at 20 Ksi for 7001-T75 Specimens with 1/4 Inch Titanium Lockbolt Fasteners	49
Table XXVII Fatigue Test Results	50

I.

INTRODUCTION

The best solution to the problem of stress corrosion cracking (SCC) of aluminum alloys is the development of alloys and tempers which are not susceptible under the operating stresses and environments. The long range objective of ARTC Project 16-61, "Stress Corrosion Cracking of Aluminum Alloys" was to encourage development of stress corrosion resistant alloys.

The Aluminum Company of America (Alcoa) and Harvey Aluminum have both developed high strength alloys resistant to SCC. Alcoa has a patent pending on their T73 temper for 7075 and Harvey for their T75 temper for 7001.

The objective of this program was to determine the stress corrosion and fatigue properties of 7001-T75 specimens having various fastener installations and to compare these results with similar data on 7075-T73, 7079-T6, 7079-T62, and 7079-T611. This data on 7075-T73 and the three tempers of 7079 was obtained from a separately contracted test program (Contract AF33(657)-7086-SA No. 2). For clarity, this latter data is included as an integral part of this report.

II.

STRESS CORROSION TESTS

1. Material

The 7001-T75 alloy plate was procured in the fully heat treated condition. The approximate size of the one-inch thick plate was 36 inches wide by 96 inches long. Specimens were machined in the long transverse grain direction as shown in Figure 1. The chemical composition and mechanical properties are tabulated in Tables I and II, respectively.

The 7075-T73 alloy plate was procured in the fully heat treated condition. The approximate size of the .75 inch thick plate was 44 inches wide by 72 inches long. Specimens were machined in the long transverse grain direction. The chemical composition and mechanical properties are tabulated in Tables I and II, respectively.

The 7079 alloy plate used in these tests was procured in the -F temper. The approximate size of the .75 inch thick plate was 44 inches wide by 72 inches long. The specimens were machined from the 7079 -F plate in the long transverse grain direction. The specimens were subsequently heat treated to the T-6, T-62, or T-611 temper at Boeing-Wichita. The -T6 temper as used in this report refers to solution treat at 820-840 degrees F plus quench in water less than 90 degrees F plus age at 230-250 degrees F for 46-48 hours. The -T62 temper is identical to the -T6 temper except quenching is accomplished in 140-160 degrees F water. The -T611 temper is identical with the -T6 temper except quenching is accomplished in 175-185 degrees F water. The chemical composition and mechanical properties of the plate are tabulated in Tables I and II, respectively.

2. Specimens

Test specimens were fabricated to process specifications and manufacturing quality standards utilized on military and commercial aircraft and components produced at the Wichita facility. Since the test articles were fabricated to representative process and quality standards, the test results offer a maximum validity for practical aircraft applications.

Specimen configuration and dimensions are shown in Figure 2. When required, holes were cold worked with a tapered steel mandrel of .0053 to .0067 inch greater diameter than the holes. Cold worked holes were deburred on the exit side by breaking the edge approximately .008 inch or 45 degree chamfer. Shot peening, when required, was done with stainless cut wire shot .047 inch in diameter. The specimens were peened all over to a depth of compression of .020 to .025 inch with a coverage of 200 percent. The shot peened specimens were carefully cleaned after peening.

3. Fasteners

After the preparation described in Paragraph 2, either steel Taper-Lok or titanium lockbolts were installed. Fastener types were 1/4 inch diameter. Interferences and clearances are shown in Tables III through XXVI.

4. Stress Corrosion Test Procedure

Specially designed constant load fixtures were used for the stress corrosion tests. The fixtures employed a lever arm arrangement and dead weights as shown in Figure 3. A specimen in the constant load test fixture is shown in Figure 4.

The actual load for each specimen was first determined using a load cell in place of the specimen. Load cells consisted of dummy specimens with strain gages attached. Loads were measured with a Baldwin SR-4 strain indicator and were accurate within ± 1.0 percent at the lower loads and ± 0.5 percent at the highest loads. After the required load had been determined, the load cell was removed, the specimen was inserted and the beam was leveled.

Alternate immersion was accomplished in a solution of 3.5 percent by weight NaCl in deionized water. A complete cycle consisted of pumping the solution into the tanks and holding for 10 minutes followed by gravity draining and drying for 50 minutes. The corrosion solutions were changed weekly.

5. Post Test Inspection

Specimens were removed from test after 2160 hours (90 days) or after failure, whichever occurred first. They were then sanded lightly and inspected for cracks. Fractographic analyses using optical and electron microscopy were made as required.

6. Test Conditions

Specimens were tested at gross area stress levels of 20, 30, and 50 ksi. These corresponded to net area stresses of 26.7, 40.0, and 66.7 ksi respectively, neglecting the stress concentration at the hole. For the 7075-T73 specimens, the applied 66.7 ksi net stress was considerably above the yield strength and was just below the ultimate. All tests were conducted to failure or to 2160 hours, whichever occurred first.

III.

STRESS CORROSION TEST RESULTS AND DISCUSSION

Stress corrosion results are tabulated in Tables III through XXVI. A comparison of stress corrosion failure times at the highest stress level, 50 ksi gross, is shown in Figures 10, 11, 12, and 13. An insufficient number of samples failed at the lower stress levels of 30 ksi and 20 ksi to make similar comparisons. A short discussion of stress corrosion results for each of the three gross area stress levels follows.

1. 20 ksi

At 20 ksi, failure occurred in only two materials and one test condition. Two 7079-T611 and three 7079-T62 unpeened specimens with steel Taper-Lok fasteners installed in non-cold worked holes with the highest interference, .0080 to .0090 inch, failed. The 7075-T73, 7001-T75, and 7079-T6 specimens did not develop detectable cracks after 2160 hours. No cracks were found in any materials which had the titanium lockbolts installed. No 7079-T6 specimens with the Taper-Lok fastener installed with .0080 to .0090 inch interference were run.

2. 30 ksi

At 30 ksi, all the 7079-T62 and 7079-T611 specimens with no peening and no hole cold working and with the steel Taper-Lok installed at .0080 to .0090 inch interference, failed. One shot peened 7079-T62 specimen with cold worked hole and Taper-Lok fastener installed with .0002 to .0007 inch interference failed outside the test area. One shot peened 7079-T62 specimen with unworked hole and titanium lockbolt installed with .0010 to .0020 inch clearance failed. One unpeened 7079-T611 specimen with cold worked hole and titanium lockbolt installed with .0010 to .0020 inch clearance failed outside the test area.

3. 50 ksi

At 50 ksi gross area stress (net area stress - 66.7 ksi), failures occurred in all alloys tested. However, stress corrosion resistance at this stress level was strongly affected by some of the variables. For example, one of the 7001-T75 specimens with titanium lockbolts failed. At least one 7001-T75 specimen with the steel Taper-Lok

failed at each of the following conditions: Low interference, no shot peening, no hole cold work; low interference, shot peened, no hole cold work; medium interference, no shot peening, no hole cold work; high interference, shot peened, no hole cold work. Figure 5 shows a failed 7001-T75 specimen and Figure 6 shows a typical stress corrosion fracture face for the 7001-T75 alloy.

The 7075-T73 specimens were tested at a net area stress level greater than FT_Y and close to FT_U . Therefore, for this alloy, the test results should not be compared directly with test results from the higher strength alloys. Three specimens broke on loading, which demonstrates that the net area stress was very close to the actual tensile strength of the material. Electron photomicrographs of a 7075-T73 specimen which survived 1161 hours of alternate immersion testing showed strong evidence of overload characterized by the preponderance of ductile dimples shown in Figure 7. However, this figure also shows an intergranular failure mode which is indicative of stress corrosion cracking. The main significance of these tests was that stress corrosion failures did occur in 7075-T73 at a stress just under the ultimate tensile strength of the material. The fact that some specimens did not fail during the 2160 hour test indicated that the critical stress level for stress corrosion cracking in this alloy (under the conditions tested) was just below the ultimate tensile strength.

Most of the 7079-T6, 7079-T62, and 7079-T611 specimens failed at 50 ksi. No significant failure pattern was evident between the alloys, type fastener, degree of interference, hole cold working, or shot peening.


On examining the data at the 50 ksi stress level shown in Figures 10, 11, 12, and 13, the particular heat of 7001-T75 tested in this program did sustain the applied stress better than the other alloys. As discussed previously, the reason for its seemingly superior stress corrosion resistance as compared to 7075-T73 probably was that the 7075-T73 was operating very close to its ultimate tensile strength. However, the 7001-T75 was clearly superior to all tempers of 7079 tested.

Figure 8 is an electron photomicrograph taken on the fracture face at the hole-to-specimen surface interface. There is no evidence of stress corrosion in this figure. This indicates that the stress corrosion did not start at this point. Figure 9 shows the typical stress corrosion appearance of the 7001-T75. The intergranular failure mode and the surface corrosion indicated by the black dots is clearly evident.

VI.

CONCLUSIONS AND RECOMMENDATIONS

1. The 7001-T75 alloy exhibited very good resistance to stress corrosion cracking at 50 ksi sustained gross stress.
2. The 7001-T75 alloy exhibited fatigue characteristics potentially superior to 7075-T73 and 7079-T62.
3. Further fatigue tests should be run so that statistically significant comparisons can be made.
4. The fracture toughness of 7001-T75 and the fabrication characteristics of this alloy should be determined.

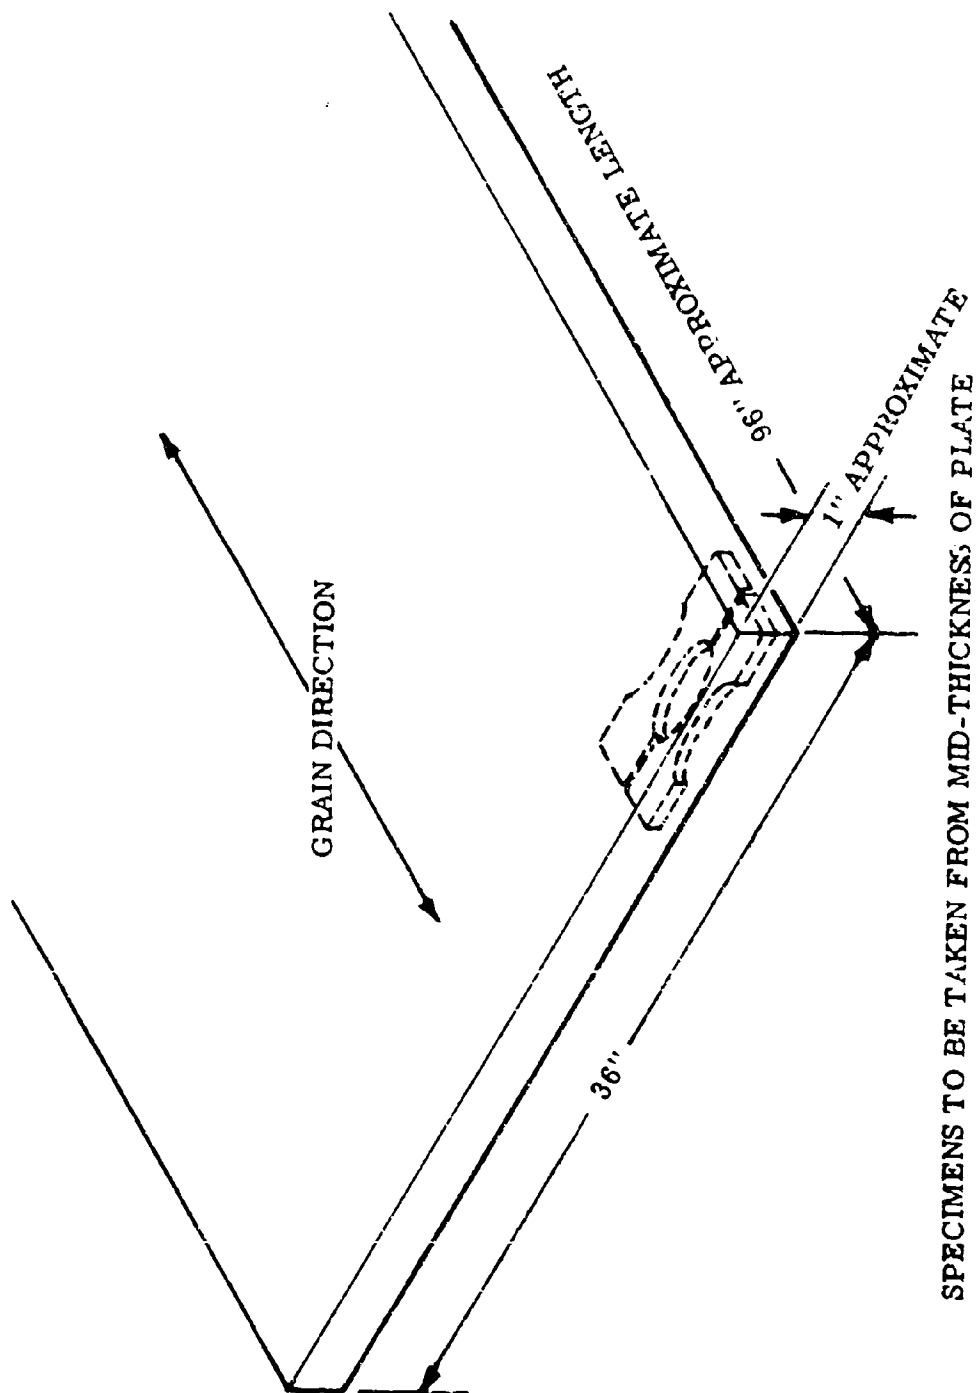

LAYOUT SKETCH - 7001-T75 PLATE FOR STRESS CORROSION SPECIMENS
FIGURE 1


NOTES:

SPECIMEN SHALL BE SYMMETRICAL WITH ϕ OF REDUCED SECTION WITHIN .001 INCH

MACHINE FINISH OF 63 RHR OR BETTER


RADIUS TO BLEND SMOOTHLY INTO REDUCED AREA, NO UNDER-CUTTING PERMITTED

THICKNESS - .1875 INCH

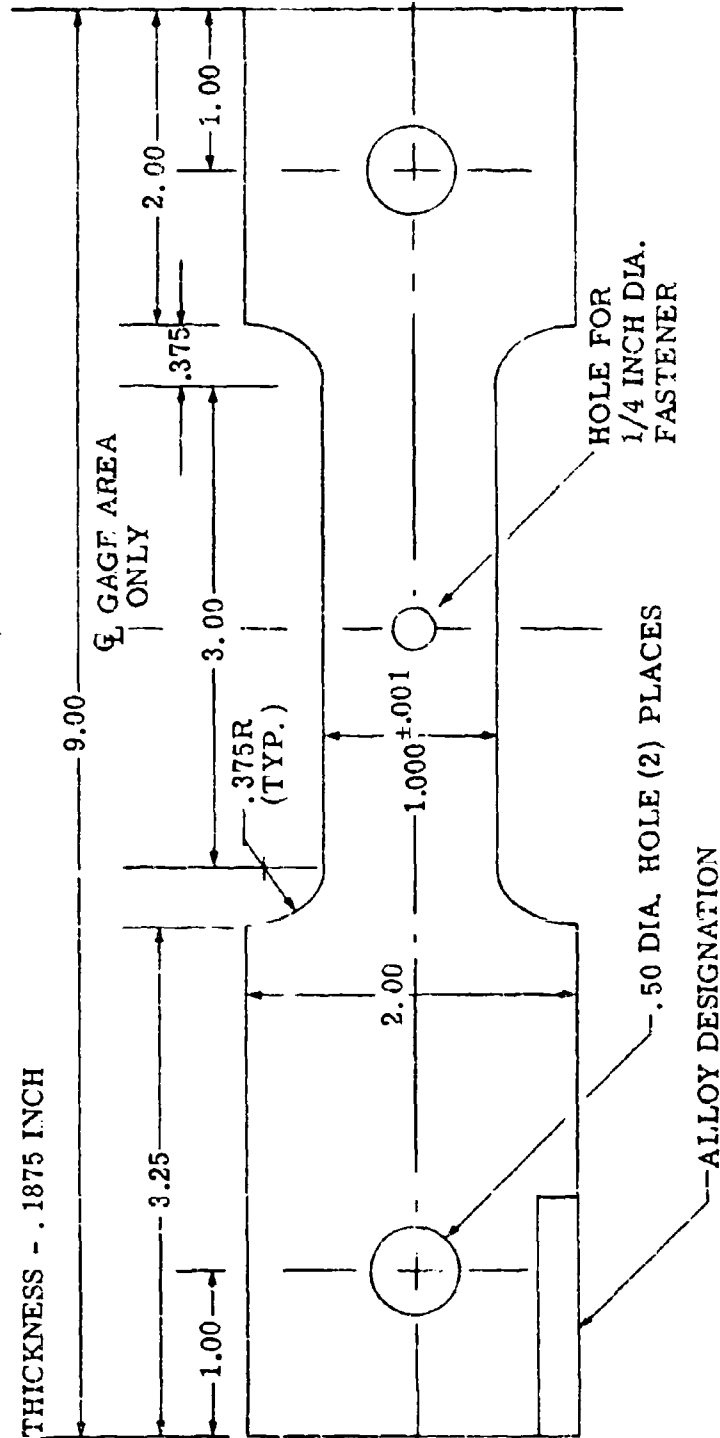

SPECIMEN CONFIGURATION - STRESS CORROSION TESTS

FIGURE 2

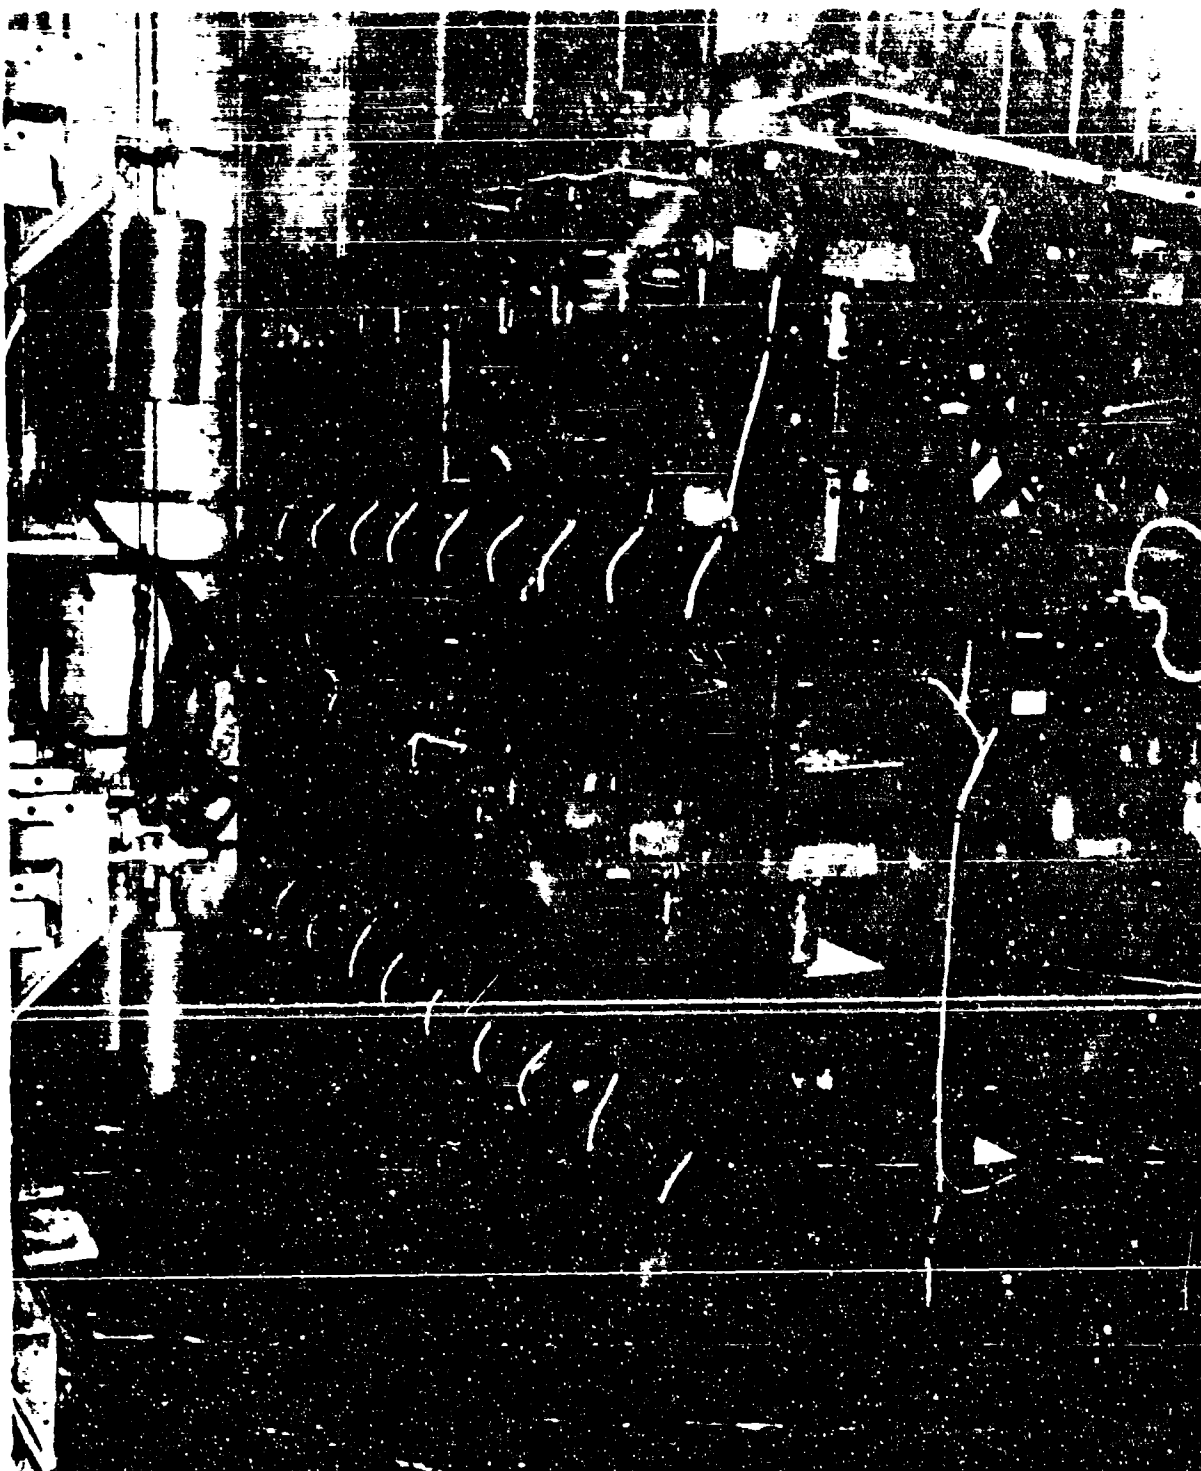


CONSTANT LOAD FIXTURE USED FOR STRESS CORROSION TESTING

FIGURE 3



SPECIMEN IN A CONSTANT LOAD STRESS CORROSION TEST FIXTURE


FIGURE 4

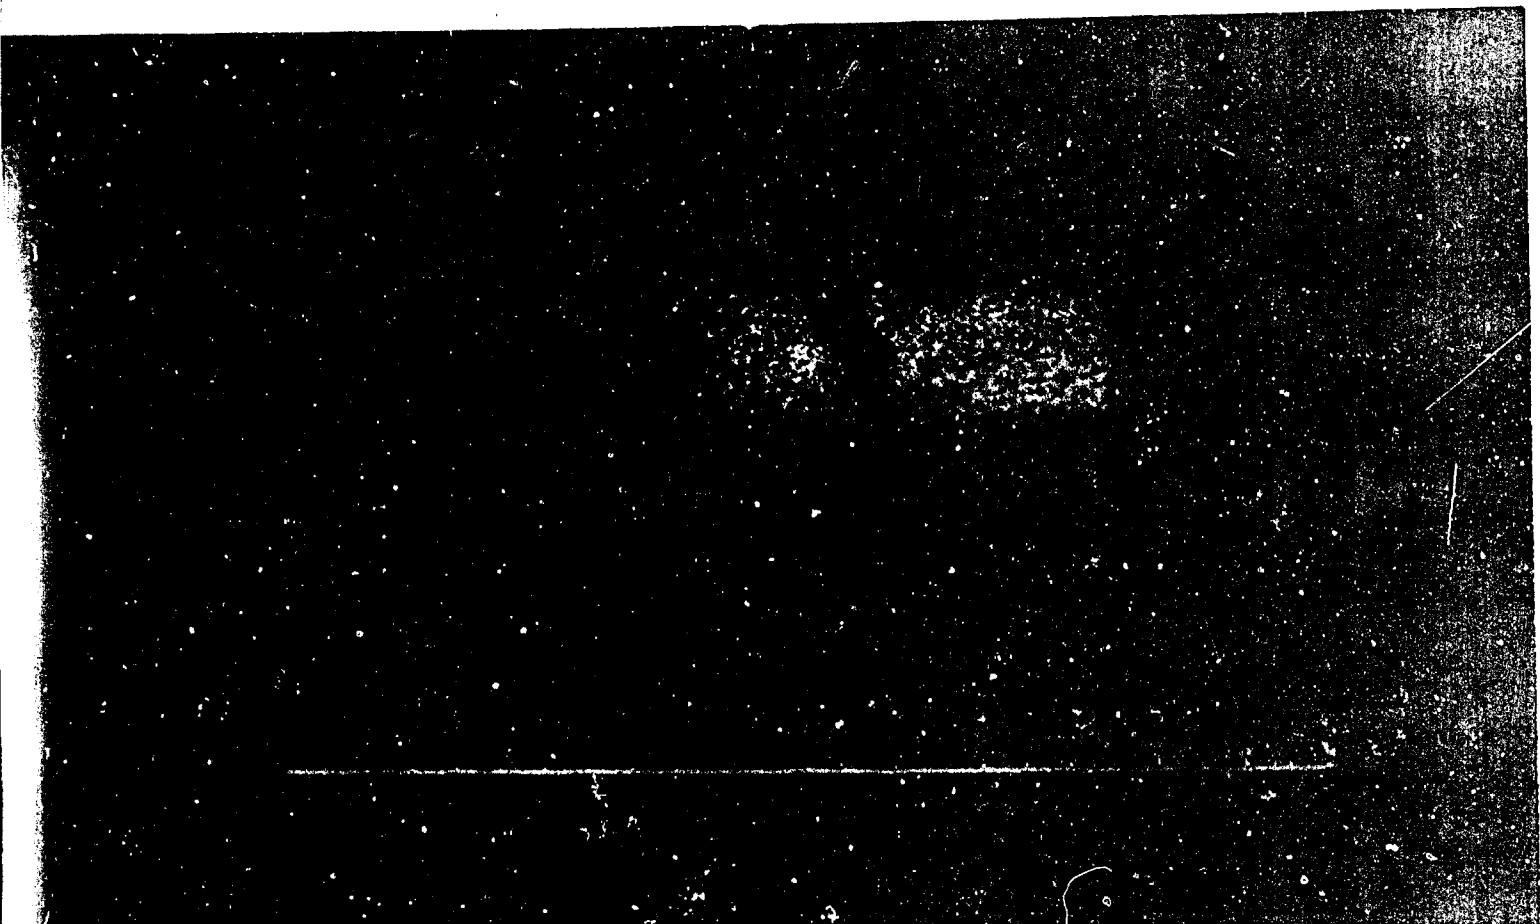

This is Specimen Number 37 which failed in 1684.6 hours at 50,000 psi gross area stress (66.7 ksi net area stress). Note the general corrosion attack in the test area. The surface of this specimen was not shot peened and the hole was not cold worked. Fastener interference was .0080 to .0090 inch.

**TYPICAL 7001-T75 SPECIMEN WITH STEEL TAPER-LOK
FASTENER WHICH FAILED BY STRESS CORROSION**

FIGURE 5

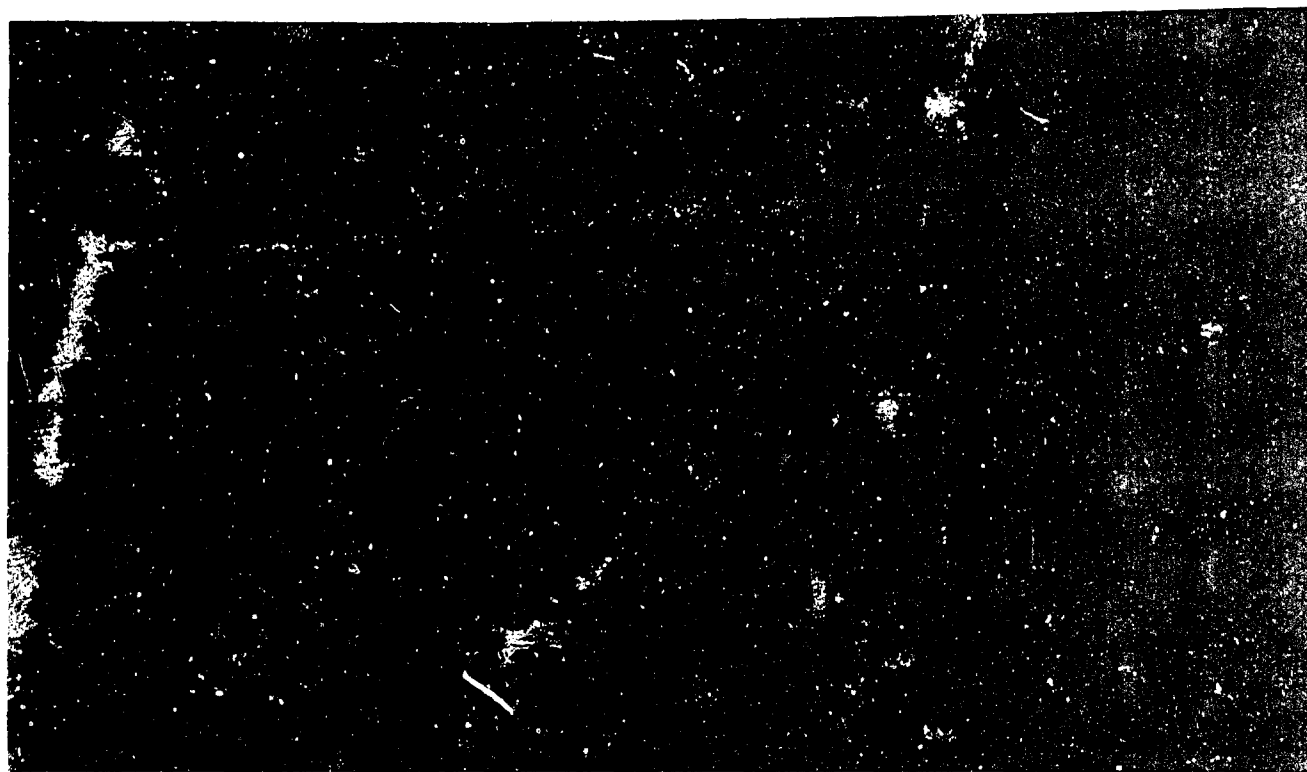

This is the fracture face of Specimen Number 121 which failed in 1992.1 hours at 50,000 psi gross area stress (66.7 ksi net area stress). The surface of this specimen was shot peened but the hole was not cold worked. A Taper-Lok fastener had been installed with .0080 to .0090 inch interference.

TYPICAL FRACTURE FACE OF 7001-T75 STRESS CORROSION SPECIMEN

FIGURE 6



10,000X

From two-stage carbon replica of fracture face on Specimen Number 229. Note the intergranular mode of failure coupled with fairly extensive ductile dimpling. This mode indicates that the failure was predominately stress corrosion and tensile overload. This specimen was not shot peened, had a titanium lockbolt installed and had no hole cold work. It failed after 1161.8 hours at 50 ksi (66.7 ksi net area stress).

ELECTRON PHOTOMICROGRAPH OF 7075-T73 STRESS CORROSION FAILURE

FIGURE 7



15,400X

From two-stage carbon replica on fracture face of Specimen Number 2. The ductile dimpling indicates the fracture mode was overload. This specimen was not shot peened, had a Taper-Lok fastener installed at .0033 to .0043 inch interference and had no hole cold work. It failed after 1992.1 hours at 50 ksi (66.7 ksi net area stress). The area shown was located at the hole-to-specimen surface intersection.

ELECTRON PHOTOMICROGRAPH OF 7001-T75 STRESS CORROSION FAILURE

FIGURE 8




6,000X

From two-stage carbon replica on fracture face of Specimen Number 2. The blocky structure and corrosion indicated by the black dots is typical of stress corrosion. See Figure 8 for description of test conditions.

ELECTRON PHOTOMICROGRAPH OF 7001-T75 STRESS CORROSION FAILURE

FIGURE 9


STRESS CORROSION TEST RESULTS AT 50 KSI (GROSS AREA STRESS) OF
SPECIMENS WITH 1/4-INCH DIAMETER TITANIUM LOCKBOLTS INSTALLED WITH
.0010 TO .0020-INCH CLEARANCE

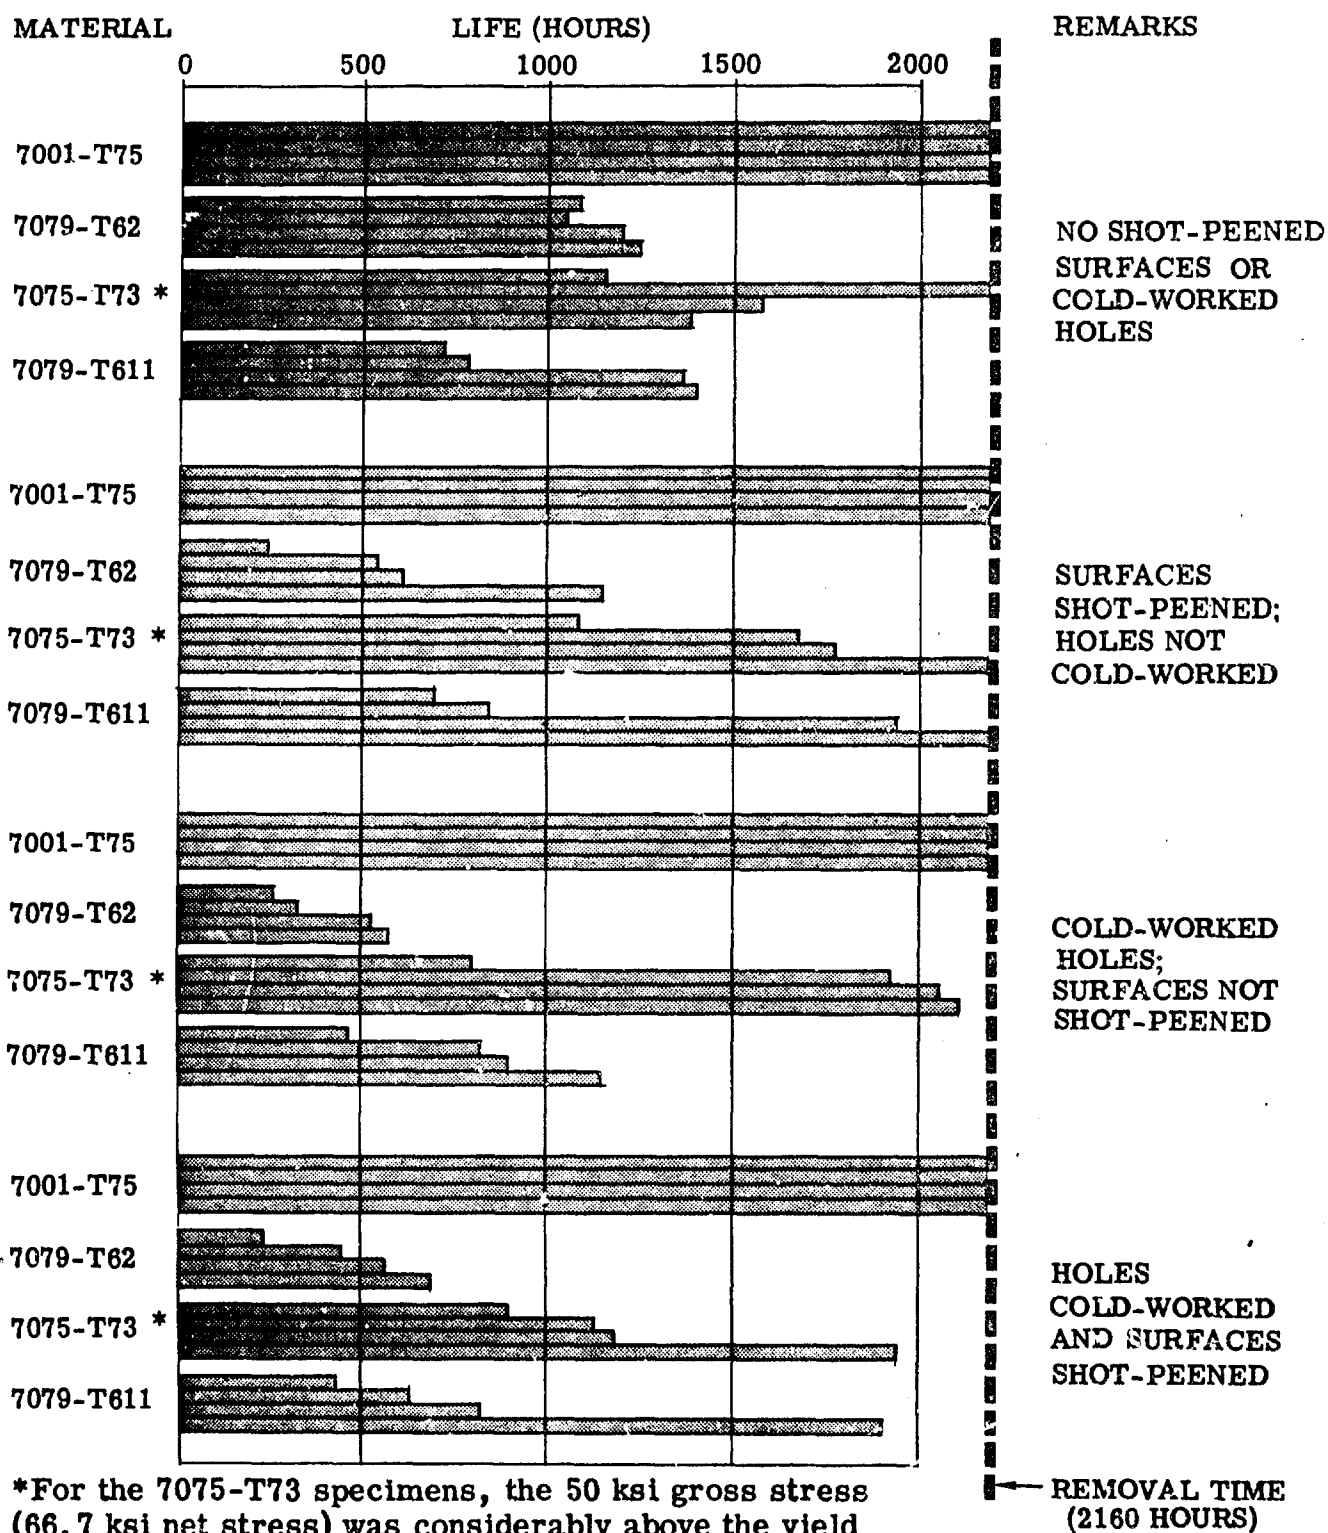

MATERIAL LIFE HOURS

FIGURE 10

**STRESS CORROSION TEST RESULTS AT 50 KSI (GROSS AREA STRESS)
SPECIMENS WITH 1/4-INCH DIAMETER STEEL TAPER-LOK FASTENERS
INSTALLED WITH LOW INTERFERENCE FIT OF .0002 TO .0007**

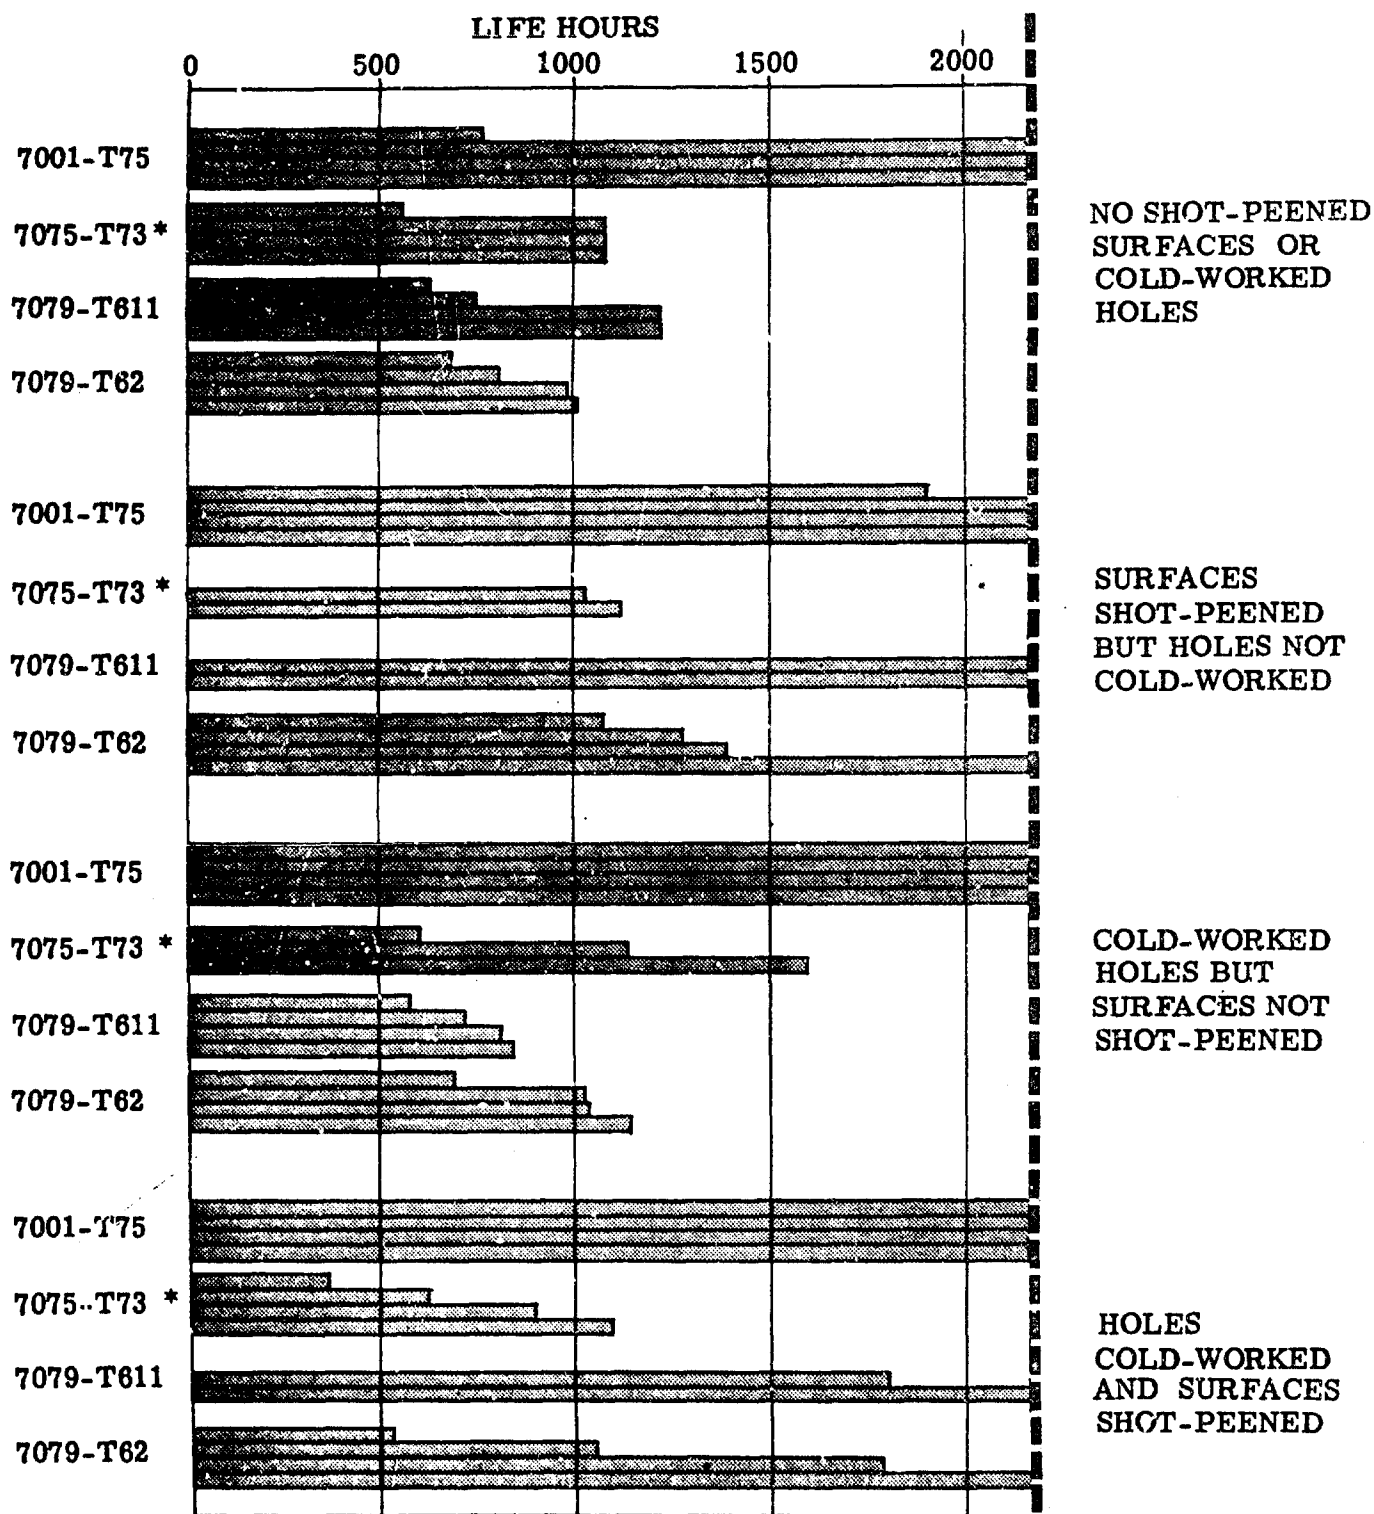


*For the 7075-T73 specimens, the 50 ksi gross stress (66.7 ksi net stress) was considerably above the yield strength and was just below the ultimate.

REMOVAL TIME
(2160 HOURS)

MATERIAL LIFE HOURS

FIGURE 11

STRESS CORROSION TEST RESULTS AT 50 KSI (GROSS AREA STRESS)
SPECIMENS WITH 1/4-INCH DIAMETER STEEL TAPER-LOK FASTENERS
INSTALLED WITH MEDIUM INTERFERENCE FIT OF .0033 TO .0043

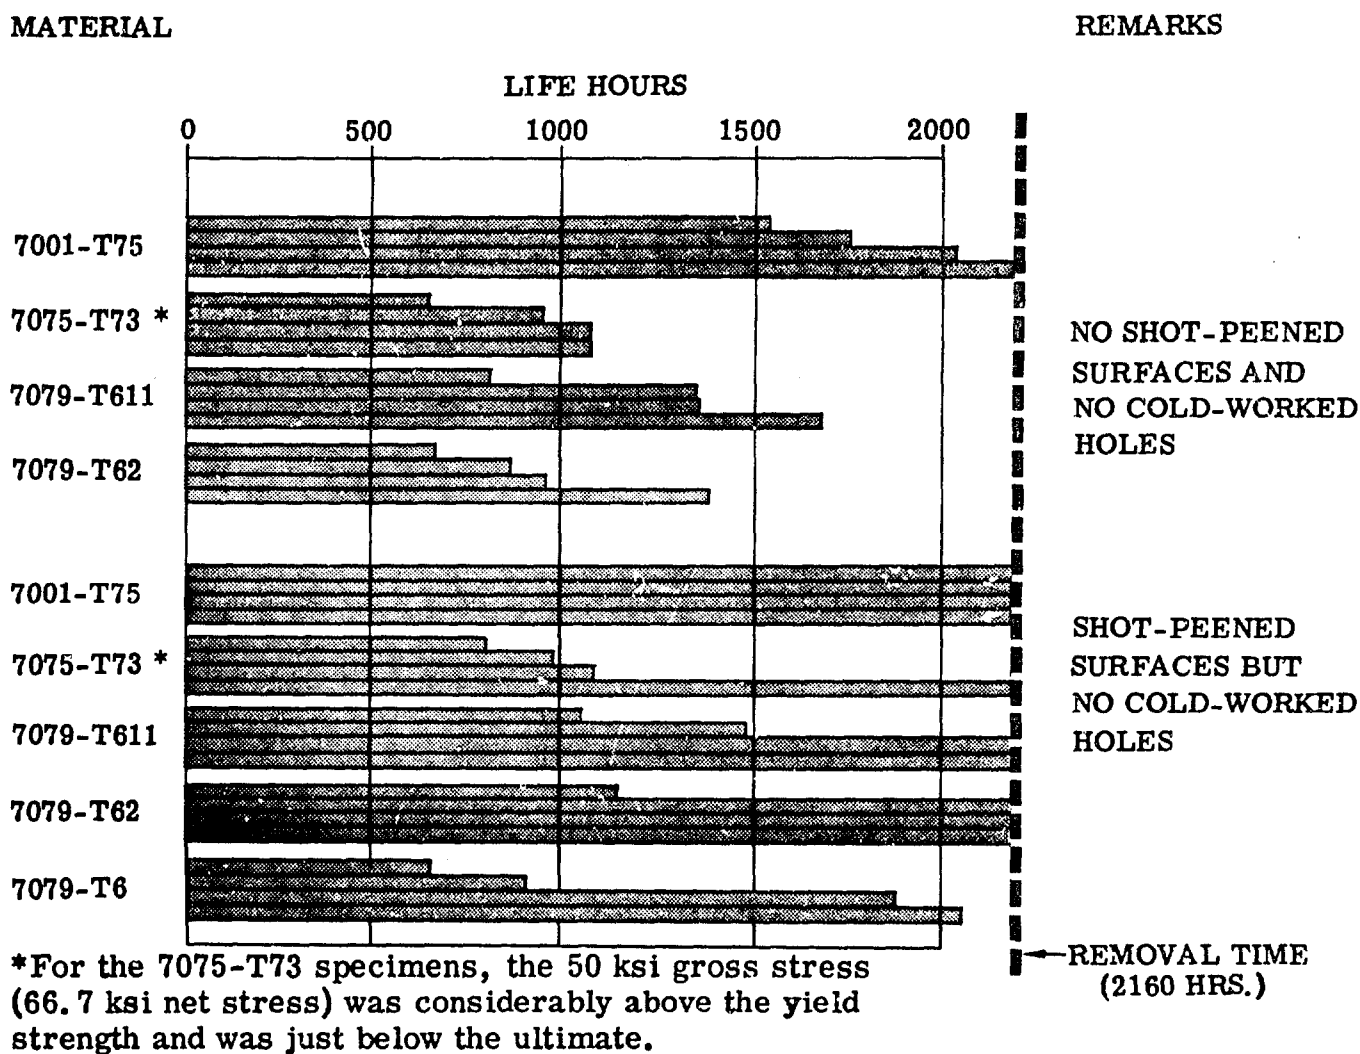


MATERIAL LIFE HOURS

FIGURE 12

**STRESS CORROSION TEST RESULTS AT 50 KSI (GROSS AREA STRESS
SPECIMENS WITH 1/4-INCH DIAMETER STEEL TAPER-LOK FASTENERS
INSTALLED WITH HIGH INTERFERENCE FIT OF .0080 to .0090**


MATERIAL

REMARKS

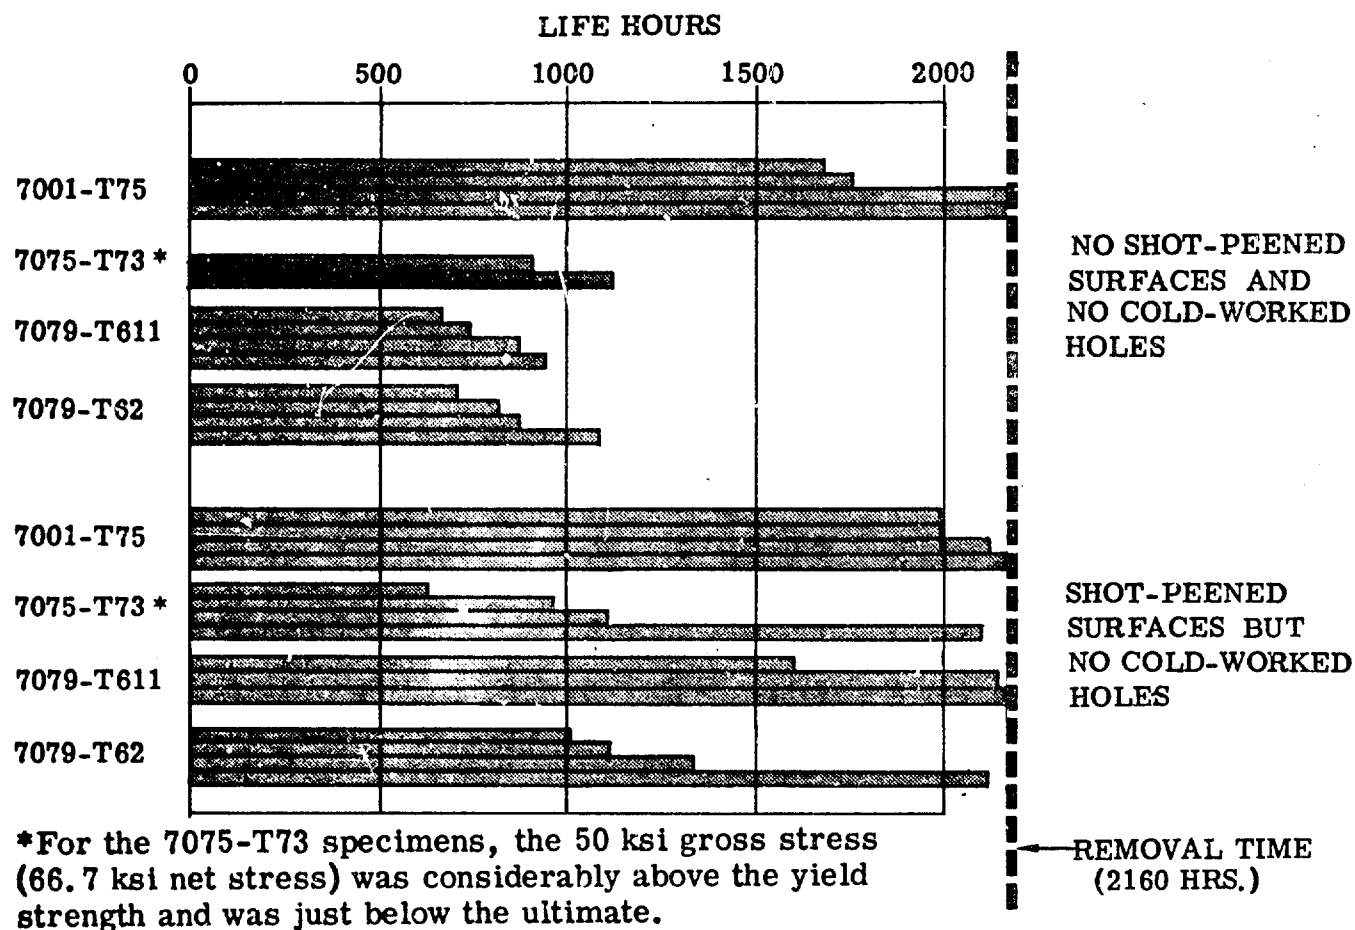


MATERIAL LIFE HOURS

FIGURE 13

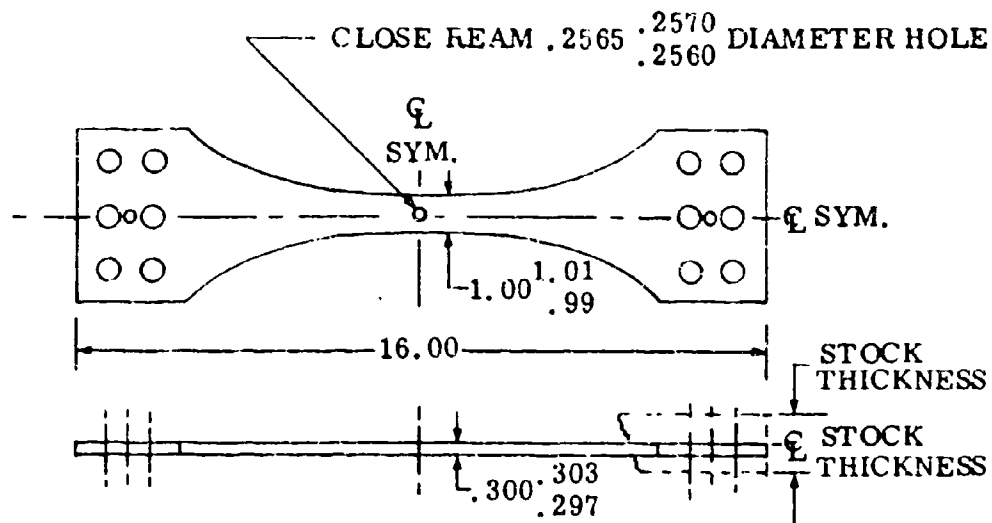

OPEN HOLE MONOBLOCK CONFIGURATION

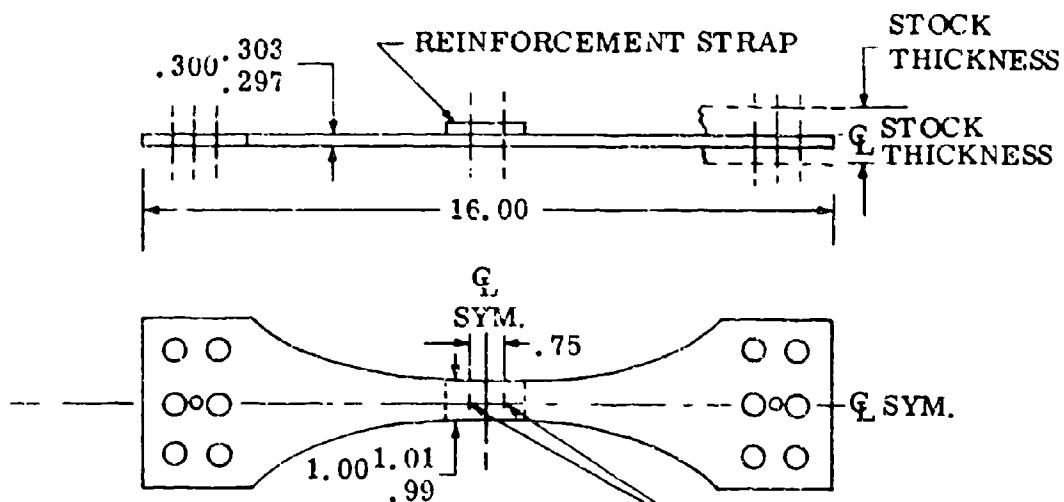

TAPER LOK BOLTS, BAC B30FW-4-9
(.25 DIAMETER), STANDARD INTERFERENCE
(PER BAC 5047), WITH FAYING SURFACE
SEALANT BETWEEN STRAP AND COUPON

STRAP REINFORCEMENT
SPECIMEN CONFIGURATION - FATIGUE TESTS

FIGURE 14

TABLE I

CHEMICAL COMPOSITION OF 7079, 7001, AND 7075

Element	Composition, Wt. Percent			
	7079*	7075*	7001*	7001**
Si	0.06	0.07	0.09	0.35 MAX.
Fe	0.11	0.13	0.12	0.40 MAX.
Cu	0.58	1.7	2.1	1.6-2.6
Mn	0.20	---	Trace	0.20 MAX.
Mg	3.5	2.6	3.1	2.6-3.4
Cr	0.22	0.26	0.21	0.18-0.40
Zn	4.2	5.5	7.2	6.8-8.0
Ti			Trace	0.20 MAX.
Others				0.15 MAX.
Balance	A1	A1	A1	A1
Lot No.	649-891	189-521		

* Analysed by Point-To-Plane Optical Emission Spectrography

** Harvey Requirement

TABLE II
MECHANICAL PROPERTIES OF TEST MATERIAL

Identification	Material	Test Direction	0.2% F _{ty} KSI	F _{tu} KSI	Elong., % in 2 Inches
Harvey Job No. 55-4624	7001-T75	Long.	74.2 74.3 73.6 68.2 68.6	81.2 81.5 81.2 77.5 78.0	12.0 12.0 11.0 11.0 12.5
		Trans.	73.6 73.7	82.0 82.4	10.5 10.0
Boeing-1 -2 -3 -4		Trans.	72.9 72.6 72.2 72.7	81.4 81.4 81.3 81.3	10.5 9.5 10.0 10.0
Boeing	7079-T6		67.7 to 68.7	78.8 to 79.5	13
<u>Note:</u> Values shown are extreme values. Six specimens were run. Remaining four values were between extremes					
Boeing	7075-T73		59.6 to 60.1	70.6 to 71.1	10.5 to 12.0
<u>Note:</u> Values shown are extreme values. Six specimens were run. Remaining four values were between extremes					

TABLE III
FAILURE TIMES AT 50 KSI FOR 7079-T62 AND 7079-T6 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
7079-T62				
25	.0002	Yes	No	1140.0
26	to	↓	↓	1036.1
27	.0007	↓	↓	1022.6
28	↓	↓	↓	697.0
49	↓	No	No	1005.1
50	↓	↓	↓	814.1
51	↓	↓	↓	979.5
52	↓	↓	↓	686.7
109	↓	Yes	Yes	1795.5
110	↓	↓	↓	1554.7
111	↓	↓	↓	NF
112	↓	↓	↓	1029.9
133	↓	No	Yes	1072.0
134	↓	↓	↓	1292.0
135	↓	↓	↓	1398.3
136	↓	↓	↓	NF
1	.0033	No	No	873.0
2	to	↓	↓	964.8
3	.0043	↓	↓	1398.1
4	↓	↓	↓	675.5
13	↓	No	No	841.8
14	↓	↓	↓	873.8
15	↓	↓	↓	642.0
16	↓	↓	↓	1031.8
97	↓	No	Yes	2060.3
98	↓	↓	↓	1149.4
99	↓	↓	↓	2164.1
100	↓	↓	↓	NF
37	.0080	No	No	813.2
38	to	↓	↓	1083.6
39	.0090	↓	↓	859.6
40	↓	↓	↓	708.0
121	↓	No	Yes	2114.6
122	↓	↓	↓	1337.2
123	↓	↓	↓	1107.0
124	↓	↓	↓	1008.6
7079-T6				
85	.0033	No	Yes	1875.5
86	to	↓	↓	920.3
87	.0043	↓	↓	657.6
88	↓	↓	↓	2052.7

NF No Failure

TABLE IV
FAILURE TIMES AT 30 KSI FOR 7079-T62 AND 7079-T6 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
7079-T62				
33	.0002	Yes	No	NF
34	to	↓	↓	NF
35	.0007	↓	↓	NF
36	↓	↓	↓	NF
57	↓	No	No	NF
58	↓	↓	↓	NF
59	↓	↓	↓	NF
60	↓	↓	↓	NF
117	↓	Yes	Yes	NF
118	↓	↓	↓	1879.4*
119	↓	↓	↓	NF
120	↓	↓	↓	NF
141	↓	No	Yes	NF
142	↓	↓	↓	NF
143	↓	↓	↓	NF
144	↓	↓	↓	**
9	.0033	No	No	NF
10	to	↓	↓	NF
11	.0043	↓	↓	NF
12	↓	↓	↓	NF
21	↓	No	No	NF
22	↓	↓	↓	NF
23	↓	↓	↓	NF
24	↓	↓	↓	NF
105	↓	No	Yes	NF
106	↓	↓	↓	NF
107	↓	↓	↓	NF
108	↓	↓	↓	NF
45	.0080	No	No	1630.6
46	to	↓	↓	1593.5
47	.0090	↓	↓	1511.0
48	↓	↓	↓	1142.5
129	↓	No	Yes	NF
130	↓	↓	↓	NF
131	↓	↓	↓	NF
132	↓	↓	↓	NF
7079-T6				
93	.0033	No	Yes	367.0*
94	to	↓	↓	NF
95	.0043	↓	↓	NF
96	↓	↓	↓	NF

* Failed Outside Test Area

** Destroyed in Machining

NF No Failure

TABLE V
FAILURE TIMES AT 20 KSI FOR 7079-T62 AND 7079-T6 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
7079-T62				
29	.0002	Yes	No	NF
30	to	↓	↓	NF
31	.0007	↓	↓	NF
32	↓	↓	↓	NF
53	↓	No	No	NF
54	↓	↓	↓	NF
55	↓	↓	↓	NF
56	↓	↓	↓	NF
113	↓	Yes	Yes	NF
114	↓	↓	↓	NF
115	↓	↓	↓	NF
116	↓	↓	↓	NF
137	↓	No	Yes	NF
138	↓	↓	↓	NF
139	↓	↓	↓	NF
140	↓	↓	↓	NF
5	.0033	No	No	NF
6	to	↓	↓	NF
7	.0044	↓	↓	NF
8	↓	↓	↓	NF
17	↓	No	No	NF
18	↓	↓	↓	NF
19	↓	↓	↓	NF
20	↓	↓	↓	NF
101	↓	No	Yes	NF
102	↓	↓	↓	NF
103	↓	↓	↓	NF
104	↓	↓	↓	NF
41	.0080	No	No	1491.0
42	to	↓	↓	NF
43	.0090	↓	↓	1880.0
44	↓	↓	↓	1537.6
125	↓	No	Yes	NF
126	↓	↓	↓	NF
127	↓	↓	↓	NF
128	↓	↓	↓	NF
7079-T6				
89	.0033	No	Yes	NF
90	to	↓	↓	NF
91	.0043	↓	↓	NF
92	↓	↓	↓	NF

NF No Failure

TABLE VI
FAILURE TIMES AT 50 KSI FOR 7079-T62 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
61	.0010	No	No	1085.0
62	to			1041.7
63	.0020	↓	↓	1205.2
64				1245.2
73		Yes	No	570.0
74		↓	↓	261.6
75				528.8
76		↓	↓	328.7
145		No	Yes	236.0
146		↓	↓	1152.6
147				612.0
148		↓	↓	540.2
157		Yes	Yes	236.0
158		↓	↓	443.7
159				694.0
160	↓	↓	↓	568.9

TABLE VII

FAILURE TIMES AT 30 KSI FOR 7079-T62 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
69	.0010	No	No	NF
70	to	↓	↓	NF
71	.0020	↓	↓	NF
72	↓			NF
81		Yes	No	NF
82		↓	↓	NF
83		↓	↓	NF
84		↓	↓	NF
153		No	Yes	NF
154		↓	↓	NF
155		↓	↓	NF
156				1940.0
165		Yes	Yes	NF
166		↓	↓	NF
167		↓	↓	NF
168		↓	↓	NF

NF No Failure

TABLE VIII

FAILURE TIMES AT 20 KSI FOR 7079-T62 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
65	.0010	No	No	NF
66	to	↓	↓	NF
67	.0020	↓	↓	NF
68	↓	↓	↓	NF
77	↓	Yes	No	NF
78	↓	↓	↓	NF
79	↓	↓	↓	NF
80	↓	↓	↓	NF
149	↓	No	Yes	NF
150	↓	↓	↓	NF
151	↓	↓	↓	NF
152	↓	↓	↓	NF
161	↓	Yes	Yes	NF
162	↓	↓	↓	NF
163	↓	↓	↓	NF
164	↓	↓	↓	NF

NF No Failure

TABLE IX
FAILURE TIMES AT 50 KSI FOR 7079-T611 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
361	.0002 to .0007	No	No	636.2
362		↓	↓	1225.6
363				753.4
364		↓	↓	1225.9
385		Yes	No	814.0
386		↓	↓	845.5
387		↓	↓	574.9
388		↓	↓	724.8
445		No	Yes	353.0*
446		↓	↓	NF
447		↓	↓	373.4
448		↓	↓	NF
469	.0033 to .0043	Yes	Yes	**
470		↓	↓	1812.0
471		↓	↓	NF
472		↓	↓	2030.0*
337		No	No	339.5
338		↓	↓	581.5
339		↓	↓	764.6
340		↓	↓	748.2
349		No	No	1366.9
350		↓	↓	1477.7
351	.0080 to .0090	↓	↓	1368.0
352		↓	↓	814.3
421		No	Yes	NF
422		↓	↓	1053.0
423		↓	↓	1485.0
424		↓	↓	NF
433		No	Yes	NF
434		↓	↓	NF
435		↓	↓	1211.6
436		↓	↓	1394.5
373	.0080 to .0090	No	No	659.0
374		↓	↓	942.7
375		↓	↓	739.5
376		↓	↓	861.2
457		No	Yes	1598.3
458		↓	↓	NF
459		↓	↓	1133.0*
460		↓	↓	2140.0

* Failed Outside Test Area
 ** Destroyed During Machining
 NF No Failure

TABLE X
FAILURE TIMES AT 30 KSI FOR 7079-T611 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
369	.0002	No	No	NF
370	to	↓	↓	NF
371	.0007	↓	↓	NF
372	↓	↓	↓	NF
393	↓	Yes	No	NF
394	↓	↓	↓	NF
395	↓	↓	↓	NF
396	↓	↓	↓	NF
453	↓	No	Yes	NF
454	↓	↓	↓	NF
455	↓	↓	↓	NF
456	↓	↓	↓	NF
477	↓	Yes	Yes	NF
478	↓	↓	↓	NF
479	↓	↓	↓	NF
480	↓	↓	↓	NF
345	.0033	No	No	NF
346	to	↓	↓	NF
347	.0043	↓	↓	NF
348	↓	↓	↓	NF
357	↓	No	No	NF
358	↓	↓	↓	NF
359	↓	↓	↓	NF
360	↓	↓	↓	NF
429	↓	No	Yes	NF
430	↓	↓	↓	NF
431	↓	↓	↓	NF
432	↓	↓	↓	**
441	↓	No	Yes	NF
442	↓	↓	↓	NF
443	↓	↓	↓	NF
444	↓	↓	↓	**
381	.0080	No	No	1922.0
382	to	↓	↓	1608.0
383	.0090	↓	↓	888.0
384	↓	↓	↓	1748.0
465	↓	No	Yes	NF
466	↓	↓	↓	NF
467	↓	↓	↓	NF
468	↓	↓	↓	**

** Destroyed During Machining
 NF No Failure

TABLE XI
FAILURE TIMES AT 20 KSI FOR 7079-611 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
365	.0002	No	No	NF
366	to	↓	↓	NF
367	.0007	↓	↓	NF
368	↓	↓	↓	NF
389	↓	Yes	No	NF
390	↓	↓	↓	NF
391	↓	↓	↓	NF
392	↓	↓	↓	NF
449	↓	No	Yes	NF
450	↓	↓	↓	NF
451	↓	↓	↓	NF
452	↓	↓	↓	NF
473	↓	Yes	Yes	NF
474	↓	↓	↓	NF
475	↓	↓	↓	NF
476	↓	↓	↓	NF
341	.0033	No	No	NF
342	to	↓	↓	NF
343	.0043	↓	↓	NF
344	↓	↓	↓	NF
353	↓	No	No	NF
354	↓	↓	↓	NF
355	↓	↓	↓	NF
356	↓	↓	↓	NF
425	↓	No	Yes	NF
426	↓	↓	↓	NF
427	↓	↓	↓	NF
428	↓	↓	↓	NF
437	↓	No	Yes	NF
438	↓	↓	↓	NF
439	↓	↓	↓	NF
440	↓	↓	↓	NF
377	.0080	No	No	1864.0
378	to	↓	↓	781.0
379	.0090	↓	↓	NF
380	↓	↓	↓	NF
461	↓	No	Yes	NF
462	↓	↓	↓	NF
463	↓	↓	↓	NF
464	↓	↓	↓	NF

NF No Failure

TABLE XII

FAILURE TIMES AT 50 KSI FOR 7079-T611 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
397	.0010	No	No	782.4
398	to			1365.2
399	.0020			721.0
400				1403.0
409		Yes	No	464.8
410				1151.2
411				900.9
412				823.6
481		No	Yes	841.8
482				694.8
483				NF
484				1940.0
493		Yes	Yes	637.7
494				819.7
495				1905.3
496				473.0

NF No Failure

TABLE XIII

FAILURE TIMES AT 30 KSI FOR 7079-T611 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
405	.0010	No	No	NF
406	to	↓	↓	NF
407	.0020	↓	↓	NF
408	↓	↓	↓	NF
417	↓	Yes	No	NF
418	↓	↓	↓	1893.0*
419	↓	↓	↓	NF
420	↓	↓	↓	NF
489	↓	No	Yes	NF
490	↓	↓	↓	NF
491	↓	↓	↓	NF
492	↓	↓	↓	NF
501	↓	Yes	Yes	NF
502	↓	↓	↓	NF
503	↓	↓	↓	NF
504	↓	↓	↓	NF

NF No Failure

* Failed Outside Test Area

TABLE XIV

**FAILURE TIMES AT 20 KSI FOR 7079-T611 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS**

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
401	.0010	No	No	NF
402	to	↓	↓	NF
403	.0020	↓	↓	NF
404	↓	↓	↓	NF
413	↓	Yes	No	NF
414	↓	↓	↓	NF
415	↓	↓	↓	NF
416	↓	↓	↓	NF
485	↓	No	Yes	NF
486	↓	↓	↓	NF
487	↓	↓	↓	NF
488	↓	↓	↓	NF
497	↓	Yes	Yes	NF
498	↓	↓	↓	NF
499	↓	↓	↓	NF
500	↓	↓	↓	NF

NF No Failure

TABLE XV
FAILURE TIMES AT 50 KSI FOR 7075-T73 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
193	.0002	No	No	566.9
194	to	↓	↓	1086.6
195	.0007	↓	↓	1086.7
196	↓	↓	↓	1086.6
217	↓	Yes	No	605.9
218	↓	↓	↓	1135.1
219	↓	↓	↓	299.8*
220	↓	↓	↓	1603.7
277	↓	No	Yes	BOL
278	↓	↓	↓	**
279	↓	↓	↓	1014.2
280	↓	↓	↓	1122.3
301	↓	Yes	Yes	354.0
302	↓	↓	↓	910.7
303	↓	↓	↓	1096.0
304	↓	↓	↓	625.8
169	.0033	No	No	979.4
170	to	↓	↓	1157.6
171	.0043	↓	↓	BOL
172	↓	↓	↓	1557.8
181	↓	No	No	656.0
182	↓	↓	↓	1074.1
183	↓	↓	↓	1074.0
184	↓	↓	↓	958.7
253	↓	No	Yes	941.7
254	↓	↓	↓	1829.7
255	↓	↓	↓	1306.8
256	↓	↓	↓	BOL
265	↓	No	Yes	812.0
266	↓	↓	↓	NF
267	↓	↓	↓	981.7
268	↓	↓	↓	1086.0
205	.0080	No	No	222.0*
206	to	↓	↓	715.0*
207	.0090	↓	↓	915.1
208	↓	↓	↓	1135.1
289	↓	No	Yes	1109.6
290	↓	↓	↓	961.8
291	↓	↓	↓	2101.9
292	↓	↓	↓	624.1

* Failed Outside Test Area

** Destroyed During Machining

NF No Failure

BOL Broke On Loading

TABLE XVI
FAILURE TIMES AT 30 KSI FOR 7075-T73 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
201	.0002	No	No	NF
202	to	↓	↓	NF
203	.0007	↓	↓	NF
204	↓	↓	↓	NF
225	↓	Yes	No	NF
226	↓	↓	↓	NF
227	↓	↓	↓	NF
228	↓	↓	↓	NF
285	↓	No	Yes	NF
286	↓	↓	↓	NF
287	↓	↓	↓	NF
288	↓	↓	↓	NF
309	↓	Yes	Yes	NF
310	↓	↓	↓	NF
311	↓	↓	↓	NF
312	↓	↓	↓	NF
177	.0033	No	No	NF
178	to	↓	↓	NF
179	.0043	↓	↓	NF
180	↓	↓	↓	NF
189	↓	No	No	NF
190	↓	↓	↓	NF
191	↓	↓	↓	NF
192	↓	↓	↓	NF
261	↓	No	Yes	NF
262	↓	↓	↓	NF
263	↓	↓	↓	NF
264	↓	↓	↓	NF
273	↓	No	Yes	NF
274	↓	↓	↓	NF
275	↓	↓	↓	NF
276	↓	↓	↓	NF
213	.0080	No	No	NF
214	to	↓	↓	NF
215	.0090	↓	↓	NF
216	↓	↓	↓	NF
297	↓	No	Yes	NF
298	↓	↓	↓	NF
299	↓	↓	↓	NF
300	↓	↓	↓	NF

NF No Failure

TABLE XVII
FAILURE TIMES AT 20 KSI FOR 7075-T73 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
197	.0002	No	No	NF
193	to	↓	↓	NF
199	.0007	↓	↓	NF
200	↓	↓	↓	NF
221	↓	Yes	No	NF
222	↓	↓	↓	NF
223	↓	↓	↓	NF
224	↓	↓	↓	NF
281	↓	No	Yes	NF
282	↓	↓	↓	NF
283	↓	↓	↓	NF
284	↓	↓	↓	NF
305	↓	Yes	Yes	NF
306	↓	↓	↓	NF
307	↓	↓	↓	NF
308	↓	↓	↓	NF
173	.0033	No	No	NF
174	to	↓	↓	NF
175	.0043	↓	↓	NF
176	↓	↓	↓	NF
185	↓	No	No	NF
186	↓	↓	↓	NF
187	↓	↓	↓	NF
188	↓	↓	↓	NF
257	↓	No	Yes	NF
258	↓	↓	↓	NF
259	↓	↓	↓	NF
260	↓	↓	↓	NF
269	↓	No	Yes	NF
270	↓	↓	↓	NF
271	↓	↓	↓	NF
272	↓	↓	↓	NF
209	.0080	No	No	NF
210	to	↓	↓	NF
211	.0090	↓	↓	NF
212	↓	↓	↓	NF
293	↓	No	Yes	NF
294	↓	↓	↓	NF
295	↓	↓	↓	NF
296	↓	↓	↓	NF

NF No Failure

TABLE XVIII

FAILURE TIMES AT 50 KSI FOR 7075-T73 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
229	.0010	No	No	1161.8
230	to	↓	↓	NF
231	.0020	↓	↓	1576.4
232	↓	↓	↓	1383.3
241	↓	Yes	No	800.9
242	↓	↓	↓	2053.8
243	↓	↓	↓	2050.9
244	↓	↓	↓	1920.6
313	↓	No	Yes	1063.8
314	↓	↓	↓	NF
315	↓	↓	↓	1771.0
316	↓	↓	↓	1672.4
325	↓	Yes	Yes	1129.6
326	↓	↓	↓	1936.0
327	↓	↓	↓	1183.7
328	↓	↓	↓	904.1

NF No Failure

TABLE XIX

FAILURE TIMES AT 30 KSI FOR 7075-T73 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
237	.0010	No	No	NF
238	to	↓	↓	NF
239	.0020	↓	↓	NF
240	↓	↓	↓	NF
249	↓	Yes	No	NF
250	↓	↓	↓	NF
251	↓	↓	↓	NF
252	↓	↓	↓	NF
321	↓	No	Yes	NF
322	↓	↓	↓	NF
323	↓	↓	↓	NF
324	↓	↓	↓	NF
333	↓	Yes	Yes	NF
334	↓	↓	↓	NF
335	↓	↓	↓	NF
336	↓	↓	↓	NF

NF No Failure

TABLE XX
FAILURE TIMES AT 20 KSI FOR 7075-T73 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
233	.0010	No	No	NF
234	to	↓	↓	NF
235	.0020	↓	↓	NF
236	↓	↓	↓	NF
245	↓	Yes	No	NF
246	↓	↓	↓	NF
247	↓	↓	↓	NF
248	↓	↓	↓	NF
317	↓	No	Yes	NF
318	↓	↓	↓	NF
319	↓	↓	↓	NF
320	↓	↓	↓	NF
329	↓	Yes	Yes	NF
330	↓	↓	↓	NF
331	↓	↓	↓	NF
332	↓	↓	↓	NF

NF No Failure

TABLE XXI
FAILURE TIMES AT 50 KSI FOR 7001-T75 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
25	.0002	No	No	NF
26	to			777.8
27	.0007			NF
28		↓	↓	NF
49		Yes	No	NF
50		↓	↓	NF
51				NF
52		↓	↓	NF
109		No	Yes	NF
110		↓	↓	NF
111				1902.0
112		↓	↓	NF
133		Yes	Yes	NF
134		↓	↓	NF
135				NF
136		↓	↓	NF
1	.0033	No	No	NF
2	to			2039.3
3	.0043			1660.0
4		↓	↓	1540.7
13		No	No	2105.3
14		↓	↓	NF
15				NF
16		↓	↓	NF
85		No	Yes	NF
86		↓	↓	NF
87				NF
88		↓	↓	NF
97		No	Yes	NF
98		↓	↓	NF
99				NF
100		↓	↓	NF
37	.0080	No	No	1684.6
38	to			1760.4
39	.0090			NF
40		↓	↓	NF
121		No	Yes	1992.1
122		↓	↓	1992.1
123				NF
124		↓	↓	2125.4

NF No Failure

TABLE XXII
FAILURE TIMES AT 30 KSI FOR 7001-T75 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
29	.0002 to .0007 ↓	No	No	NF
30		↓	↓	NF
31				NF
32				NF
53		Yes	No	NF
54		↓	↓	NF
55				NF
56				NF
113		No	Yes	NF
114		↓	↓	NF
115				NF
116				NF
137		Yes	Yes	NF
138		↓	↓	NF
139				NF
140				NF
5	.0033 to .0043 ↓	No	No	NF
6		↓	↓	NF
7				NF
8				NF
17		No	No	NF
18		↓	↓	NF
19				NF
20				NF
89		No	Yes	NF
90		↓	↓	NF
91				NF
92				NF
101		No	Yes	NF
102		↓	↓	NF
103				NF
104				NF
41	.0080 to .0090 ↓	No	No	NF
42		↓	↓	NF
43				NF
44				NF
125		No	Yes	NF
126		↓	↓	NF
127				NF
128				NF

NF No Failure

TABLE XXIII

FAILURE TIMES AT 20 KSI FOR 7001-T75 SPECIMENS
WITH 1/4 INCH STEEL TAPER-LOK FASTENERS

Specimen No.	Interference, Inch	Cold Worked Holes	Shot Peened	Failure Times Hours
33	.0002 to .0007	No	No	NF
34		↓	↓	NF
35				NF
36				NF
57				NF
58				NF
59				NF
60				NF
117				NF
118				NF
119				NF
120				NF
141				NF
142				NF
143				NF
144				NF
9	.0033 to .0043	No	No	NF
10		↓	↓	NF
11				NF
12				NF
21				NF
22				NF
23				NF
24				NF
93				NF
94				NF
95				NF
96				NF
105				NF
106				NF
107				NF
108				NF
45	.0080 to .0090	No	No	NF
46		↓	↓	NF
47				NF
48				NF
129				NF
130				NF
131				NF
132				NF

NF No Failure

TABLE XXIV

FAILURE TIMES AT 50 KSI FOR 7001-T75 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
61	.0010	No	No	NF
62	to	↓	↓	NF
63	.0020	↓	↓	NF
64	↓	↓	↓	NF
73	↓	Yes	No	NF
74	↓	↓	↓	NF
75	↓	↓	↓	NF
76	↓	↓	↓	NF
145	↓	No	Yes	NF
146	↓	↓	↓	NF
147	↓	↓	↓	NF
148	↓	↓	↓	NF
157	↓	Yes	Yes	NF
158	↓	↓	↓	NF
159	↓	↓	↓	NF
160	↓	↓	↓	NF

NF No Failure

TABLE XXV

FAILURE TIMES AT 30 KSI FOR 7001-T75 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
65	.0010	No	No	NF
66	to	↓	↓	NF
67	.0020	↓	↓	NF
68	↓	↓	↓	NF
77	↓	Yes	No	NF
78	↓	↓	↓	NF
79	↓	↓	↓	NF
80	↓	↓	↓	NF
149	↓	No	Yes	NF
150	↓	↓	↓	NF
151	↓	↓	↓	NF
152	↓	↓	↓	NF
161	↓	Yes	Yes	NF
162	↓	↓	↓	NF
163	↓	↓	↓	NF
164	↓	↓	↓	NF

NF No Failure

TABLE XXVI
FAILURE TIMES AT 20 KSI FOR 7001-T75 SPECIMENS
WITH 1/4 INCH TITANIUM LOCKBOLT FASTENERS

Specimen No.	Clearance, Inch	Cold Worked Holes	Shot Peened	Failure Time Hours
69	.0010	No	No	NF
70	to	↓	↓	NF
71	.0020	↓	↓	NF
72	↓	↓	↓	NF
81	↓	Yes	No	NF
82	↓	↓	↓	NF
83	↓	↓	↓	NF
84	↓	↓	↓	NF
153	↓	No	Yes	NF
154	↓	↓	↓	NF
155	↓	↓	↓	NF
156	↓	↓	↓	NF
165	↓	Yes	Yes	NF
166	↓	↓	↓	NF
167	↓	↓	↓	NF
168	↓	↓	↓	NF

NF No Failure

TABLE XXVII
FATIGUE TEST RESULTS

Test Stress and Specimen Configuration	No.	Cycles to Failure		
		7001-T75	7075-T73	7079-T62
15 \pm 5 ksi Monoblock W/Open Hole	1	10,000,000+	121,000	85,000
	2	4,000,000+	223,000	291,000
	3	4,000,000+	141,000	97,000
	4	4,000,000+	205,000	93,000
	Log Mean (Scatter)	4,000,000+ --	167,000 (61%)	123,000 (167%)
15 \pm 10 Monoblock W/Open Hole	1	42,000	36,000	13,000
	2	44,000	27,000	14,000
	3	47,000	34,000	15,000
	4	55,000	21,000	17,000
	Log Mean (Scatter)	47,000 (28%)	29,000 (52%)	15,000 (27%)
15 \pm 10 Strap Reinforce- ment W/Taper- Lok Fasteners	1	405,000	450,000	1,934,000
	2	376,000	391,000	312,000
	3	366,000	370,000	753,000
	4	677,000	362,000	561,000
	Log Mean (Scatter)	438,000 (71%)	392,000 (23%)	711,000 (228%)

Unclassified
Security Classification

DOCUMENT CONTROL DATA - R&D		
(Security classification of title, body of abstract and indexing annotation must be entered when the overall report is classified)		
1. ORIGINATING ACTIVITY (Corporate author) The Boeing Company Wichita Division Wichita, Kansas		2a. REPORT SECURITY CLASSIFICATION Unclassified
		2b. GROUP
3. REPORT TITLE Stress Corrosion and Fatigue Tests on 7001-T75 Aluminum Alloy		
4. DESCRIPTIVE NOTES (Type of report and inclusive dates)		
5. AUTHOR(S) (Last name, first name, initial) Evans, William E. Chambers, Albert G.		
6. REPORT DATE	7a. TOTAL NO. OF PAGES	7b. NO. OF REFS
8a. CONTRACT OR GRANT NO. AF33(657)-7086 - CCN 4 (4N-860)	9a. ORIGINATOR'S REPORT NUMBER(S)	
b. PROJECT NO. 7381		
c. Task No. 738103	9b. OTHER REPORT NO(S) (Any other numbers that may be assigned this report) AFML-TR66-12	
10. AVAILABILITY/LIMITATION NOTICES This document is subject to special export controls and each transmittal to foreign governments or foreign nationals may be made only with prior approval of the Air Force Materials Laboratory (MAAS), Wright Patterson Air Force Base, Ohio 45433		
11. SUPPLEMENTARY NOTES	12. SPONSORING MILITARY ACTIVITY Air Force Materials Laboratory Research and Technology Division, Air Force Systems Command, Wright-Patterson AFB, Ohio	
13. ABSTRACT Test specimens of 7001-T75 aluminum alloy were evaluated for resistance to stress corrosion and for fatigue characteristics. Alternate immersion stress corrosion tests were performed at gross area stress levels of 50 ksi, 30 ksi, and 20 ksi with steel Taper-Lok and titanium lockbolt fasteners installed in plain and cold worked holes. These fasteners were installed with clearance and interference fits. This report also includes, for comparison purposes, similar stress corrosion data on 7075-T73, 7079-T7, 7079-T62, and 7079-T611 aluminum alloy. The data for these four alloys was obtained from a separate contract. Fatigue tests were performed at 15 ± 5 ksi and 15 ± 10 ksi mean plus alternating stress levels. The test configurations included an open hole mono-block design and a strap reinforcement design with steel Taper-Lok fasteners. This report also includes, for comparison purposes, similar fatigue test data on 7075-T73 and 7079-T62 aluminum alloys. The data for these two alloys was obtained from a separate contract. The 7001-T75 alloy exhibited very good resistance to stress corrosion cracking at 50 ksi gross area sustained stress. The limited number of fatigue tests indicated that the 7001-T75 alloy is potentially superior to 7075-T73 and 7079-T62.		

DD FORM 1473
1 JAN 64

Unclassified
Security Classification

Security Classification

14 KEY WORDS	LINK A		LINK B		LINK C	
	ROLE	WT	ROLE	WT	ROLE	WT
7001-T75						
7075-T73						
7079-T6						
7079-T62						
7079-T611						
stress corrosion						
fatigue						

INSTRUCTIONS

1. **ORIGINATING ACTIVITY:** Enter the name and address of the contractor, subcontractor, grantee, Department of Defense activity or other organization (*corporate author*) issuing the report.

2a. **REPORT SECURITY CLASSIFICATION:** Enter the overall security classification of the report. Indicate whether "Restricted Data" is included. Marking is to be in accordance with appropriate security regulations.

2b. **GROUP:** Automatic downgrading is specified in DoD Directive 5200.10 and Armed Forces Industrial Manual. Enter the group number. Also, when applicable, show that optional markings have been used for Group 3 and Group 4 as authorized.

3. **REPORT TITLE:** Enter the complete report title in all capital letters. Titles in all cases should be unclassified. If a meaningful title cannot be selected without classification, show title classification in all capitals in parenthesis immediately following the title.

4. **DESCRIPTIVE NOTES:** If appropriate, enter the type of report, e.g., interim, progress, summary, annual, or final. Give the inclusive dates when a specific reporting period is covered.

5. **AUTHOR(S):** Enter the name(s) of author(s) as shown on or in the report. Enter last name, first name, middle initial. If military, show rank and branch of service. The name of the principal author is an absolute minimum requirement.

6. **REPORT DATE:** Enter the date of the report as day, month, year, or month, year. If more than one date appears on the report, use date of publication.

7a. **TOTAL NUMBER OF PAGES:** The total page count should follow normal pagination procedures, i.e., enter the number of pages containing information.

7b. **NUMBER OF REFERENCES:** Enter the total number of references cited in the report.

8a. **CONTRACT OR GRANT NUMBER:** If appropriate, enter the applicable number of the contract or grant under which the report was written.

8b, 8c, & 8d. **PROJECT NUMBER:** Enter the appropriate military department identification, such as project number, subproject number, system numbers, task number, etc.

9a. **ORIGINATOR'S REPORT NUMBER(S):** Enter the official report number by which the document will be identified and controlled by the originating activity. This number must be unique to this report.

9b. **OTHER REPORT NUMBER(S):** If the report has been assigned any other report numbers (*either by the originator or by the sponsor*), also enter this number(s).

10. **AVAILABILITY/LIMITATION NOTICES:** Enter any limitations on further dissemination of the report, other than those

imposed by security classification, using standard statements such as:

- (1) "Qualified requesters may obtain copies of this report from DDC."
- (2) "Foreign announcement and dissemination of this report by DDC is not authorized."
- (3) "U. S. Government agencies may obtain copies of this report directly from DDC. Other qualified DDC users shall request through _____."
- (4) "U. S. military agencies may obtain copies of this report directly from DDC. Other qualified users shall request through _____."
- (5) "All distribution of this report is controlled. Qualified DDC users shall request through _____."

If the report has been furnished to the Office of Technical Services, Department of Commerce, for sale to the public, indicate this fact and enter the price, if known.

11. **SUPPLEMENTARY NOTES:** Use for additional explanatory notes.

12. **SPONSORING MILITARY ACTIVITY:** Enter the name of the departmental project office or laboratory sponsoring (*paying for*) the research and development. Include address.

13. **ABSTRACT:** Enter an abstract giving a brief and factual summary of the document indicative of the report, even though it may also appear elsewhere in the body of the technical report. If additional space is required, a continuation sheet shall be attached.

It is highly desirable that the abstract of classified reports be unclassified. Each paragraph of the abstract shall end with an indication of the military security classification of the information in the paragraph, represented as (TS), (S), (C), or (U).

There is no limitation on the length of the abstract. However, the suggested length is from 150 to 225 words.

14. **KEY WORDS:** Key words are technically meaningful terms or short phrases that characterize a report and may be used as index entries for cataloging the report. Key words must be selected so that no security classification is required. Identifiers, such as equipment model designation, trade name, military project code name, geographic location, may be used as key words but will be followed by an indication of technical context. The assignment of links, rules, and weights is optional.